


EAST JAVA FLAMINGO

MARBLE • HONED


East Java offers a luxurious feel with a tropical twist. Choose from bricks, the feathery Plume mosaic, or the geometric brilliance of the Temple mosaic. We recommend combining these options for maximum impact.



PLUME MOSAIC

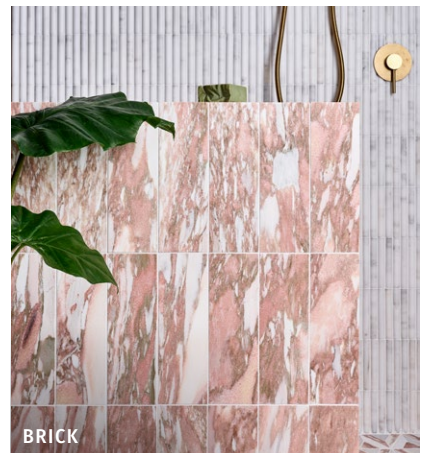


BRICK

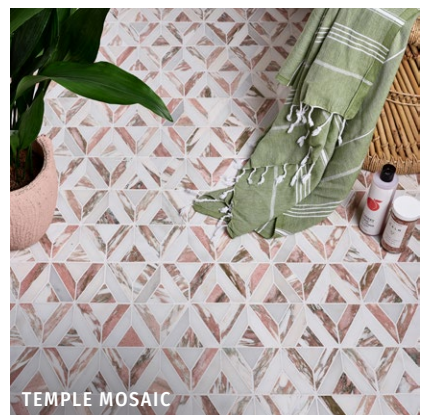

TEMPLE MOSAIC

OPTION	FORMAT (CM)	SHEETS/M ²	SOLD BY	AVAILABILITY	Suitable for interior walls and floors, sealing with Stain Block Eco required. Supplied on mesh sheets for easy installation.
PLUME MOSAIC	35 x 30.3 x 1	9.433	Sheet	Usually in stock	
TEMPLE MOSAIC	30.3 x 35 x 1	9.288	Sheet	Usually in stock	
BRICK	10 x 30.5 x 1	-	0.03m ²	Usually in stock	

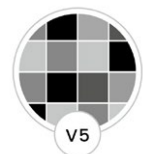



TEMPLE MOSAIC



PLUME MOSAIC



BRICK

TECHNICAL DATA

Petrographic Analysis

Calclitic-Dolomitic Marble

TEST	STANDARD	RESULT
Compressive Strength	BS EN 1926	98Mpa
Apparent Density	BS EN 1936 : 2006	2760Kg/m ³
Frost Resistance (56 Cycles)	BS EN 12371 : 2010	3.6%
Flexural Strength (3 Point)	BS EN 12372 : 2006	12.3Mpa
Water Absorption at Atmospheric Pressure	BS EN 13755 : 2008	01%
Determination Of Abrasive Index 2000Rpm	BS EN 14157	6.71Mm
Slip Resistance (Dry)	BS EN 14231 : 2003	Brick: PTV 46 Plume Mosaic: PTV 62.6 Temple Mosaic: PTV 69.7
Slip Resistance (Wet)	BS EN 14231 : 2003	Brick: PTV 24.7 Plume Mosaic: PTV 43.8 Temple Mosaic: PTV 36.8

- ✓ Suitable for use with underfloor heating
- ✓ Suitable for use in wet areas

For any further information or advice, please contact our team.

INSTALLATION, CARE & MAINTENANCE ADVICE

Please refer to the installation guides on our website. For more information on Mosaic tiles, please see the info sheet on our website, 'Understanding Mosaic Tiles'.

Please note that in order to avoid any staining issues, we do not recommend the use of a spirit based sealer such as Stain Block, as this may react with the glue that holds the mosaic sheet together.

PRODUCT NOTES

This marble has a high degree of tonal variation. There are some areas of orange markings caused by higher iron content. If this is not liked, we would recommend these tiles or tesserae are removed.